

Date: Monday, 04/05/2009 1:47:05 PM
User: Linda Lacelle

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: WEARPAD
Job Number	: 47715 -1	Part Number	: D35371 <i>GY</i>
Estimate Number	: 12712	Drawing Number	: D3537 REV C
P.O. Number	:	Project Number	: N/A
This Issue	: 04/05/2009 S.O. No. :	Drawing Revision	: C
Prsht Rev.	: NC	Material	:
First Issue	: / / Type : SMALL /MED FAB	Due Date	: 20/05/2009
Previous Run	: 47530	Qty:	<i>(20)</i> 80 Um: Each
Written By	:		
Checked & Approved By	: <i>JLD 09.05.06</i>		
Comment	: Est Rev:A New Issue 07-02-14 JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	M304S16GA	304/316 Sheet .063
-----	-----------	--------------------



Comment: Qty.: 0.1113 sf(s)/Unit Total : 6.6780 sf(s)
M304S16GA .063" 304 SS SHEET
Batch: *111323* *IB 9-5-21*

2.0	WATER JET	FLOW WATER JET
-----	-----------	----------------



Comment: FLOW WATER JET
1-Cut as per Dwg D3537
Dwg Rev: *C*
Prog Rev: *C*

IB 9-5-21

2-Deburr if necessary

IB 9-5-21

(74)

3.0	QC2	INSPECT PARTS AS THEY COME OFF MACHINE
-----	-----	--



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

IB 9-5-21

4.0	QC8	SECOND CHECK
-----	-----	--------------



Comment: SECOND CHECK

S 27/05/21 *counter* *(X74)*

5.0	BRAKE NC	NC BRAKE
-----	----------	----------



Comment: NC BRAKE

1-Form as per Dwg D3537 on CNC brake using Jigs DT 8261 and DT 8326.
2-Identify as D3537-1

S 29/05/21

(74)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 04/05/2009 1:47:06 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: WEARPAD

Job Number: 47715

Part Number: D35371

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

Qty Description
A/R 2059B Hardcoat

Batch

M111585

1-Weld as per Dwg D3537 using Jig DT 8210

2-Remove any weld that penetrated through Wearpad if necessary

BR 9-5-26 (X74)

7.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

509/5/26 (20) center

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

509/5/26 (X20)

9.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat Grey Sandtex (Ref: 4.3.5.6) as per QSI 005 4.3

M109091

START TIME:

2:00pm

OVEN TEMPERATURE:

320°F

FINISH TIME:

2:30pm

HL 09-05-26 (X20)

10.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BR 09-05-26 (20)

11.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location:

FR-17

BR 09-05-26 (7)

12.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

09/05/26

Job Completion



0209/05/26

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


D3537-1F FLAT PATTERN

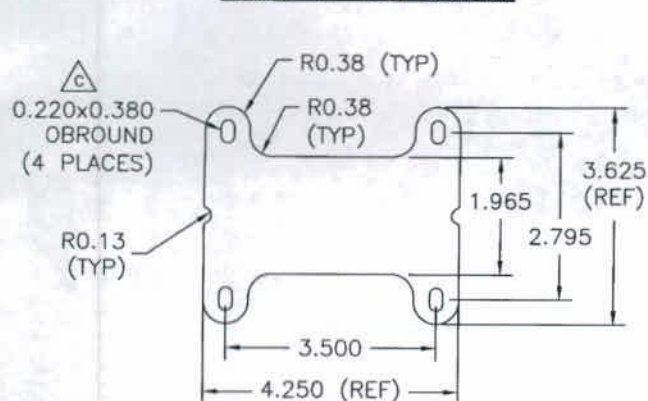


D3537-3F FLAT PATTERN

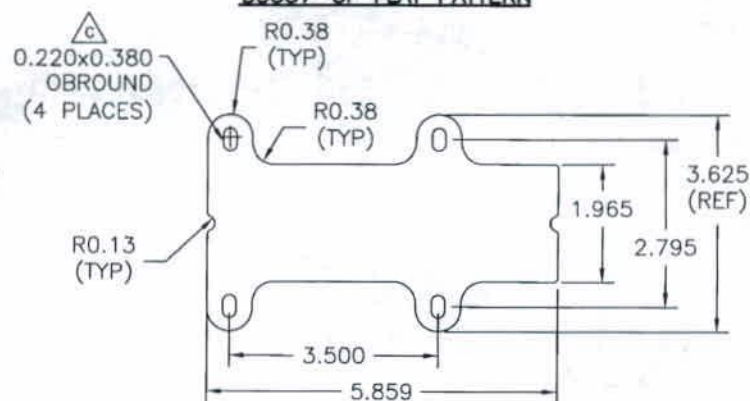


D3537-1 LONGITUDINAL BEND (MADE FROM D3537-1F)

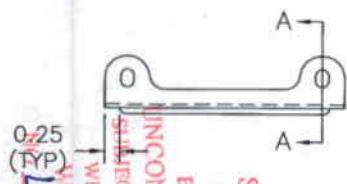


D3537-3 LONGITUDINAL BEND (MADE FROM D3537-3F)

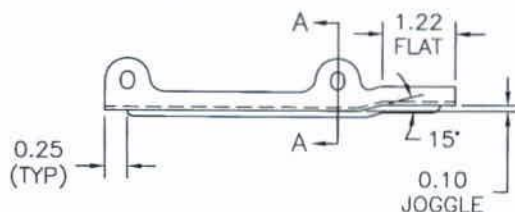

D3537-5 LONGITUDINAL BEND (MADE FROM D3537-1F)

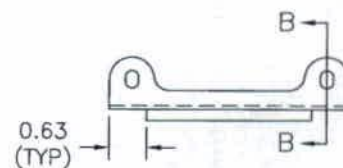


SECTION A-A

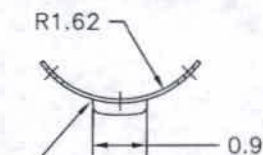


APPLY 2 LAYERS OF
2059B HARDCOAT WELDS
TO WITHIN 0.25 OF
WEARPAD ENDS
0.188 TO 0.250 THICK

SECTION B-B

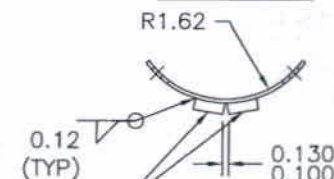

D2941-300
REMOVE POWDER
COAT FROM THESE
SURFACES

D3537-7 LONGITUDINAL BEND (MADE FROM D3537-3F)

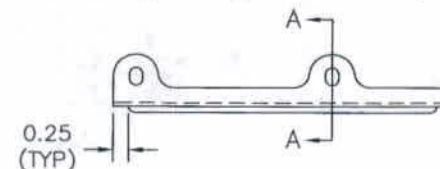

D3537-1/-3/-5/-7 WEARPAD NOTES

- 1) MATERIAL: AISI 304/316 SS SHEET PER AMS 5513 OR AMS 5524, 16 GAUGE (0.063 THICK)
(REF DART SPEC. M304S16GA)
- 2) BREAK ALL SHARP CORNERS 0.063 MAX
- 3) WELD PER QSI 004
- 4) FINISH: POWDER COAT GREY SANDTEX (4.3.5.6) PER QSI 005 4.3
- 5) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 6) ALL DIMENSIONS ARE IN INCHES

COPYRIGHT © 2006 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

DESIGN	C.B.	DRAWN BY	PH	DART AEROSPACE USA, INC.
CHECKED	A	APPROVED	A	PORT HAZARD, MA
DATE	07.04.13	DRAWING NO.	D3537	REV. C
		TITLE	WEARPAD	SHEET 1 OF 1
				SCALE
				1:2

RELEASED
07.05.08 PM
REV ELN
952